

X Axis iloop

1. Open VNC Viewer, enter IP Address, type password (ulsxl).
2. Press Q on keyboard.
3. When VNC Viewer opens, select the Windows Icon (start).
4. On keyboard press Q to quit.
5. Select ULS from the Admin folder.
6. Using the up folder go to C:\Program Files\Copely motion
7. Double click CME2
8. Double click CME2.EXE.
9. Choose X Motion.
10. From the block diagram choose iloop.
11. Cp: should read 475.
12. Ci: should read 129, change to 79. (If motor is making noise)
13. Press close.
14. Flash to EPROM.
15. From the Menu Bar choose amplifier.
16. Next choose Control Panel.
17. Change to Software Enable Amplifier.
18. Exit

