

MVX 155 STYLE CPU RESET


The 132-0155-00-A CPU is used on the M-360, V-460, X-660, X2-660, Superspeed 660 and some versions of the V-400, X-600, X2-600 & Superspeed 600 models.

MAKE SURE THE POWER IS TURNED OFF AND THE MAIN POWER CORD IS DISCONNECTED FROM THE ENGRAVER BEFORE PROCEEDING

Step 1 – Locate and remove the screws that hold the CPU cover in place behind the engraver:



Step 2 – The CPU is now exposed:

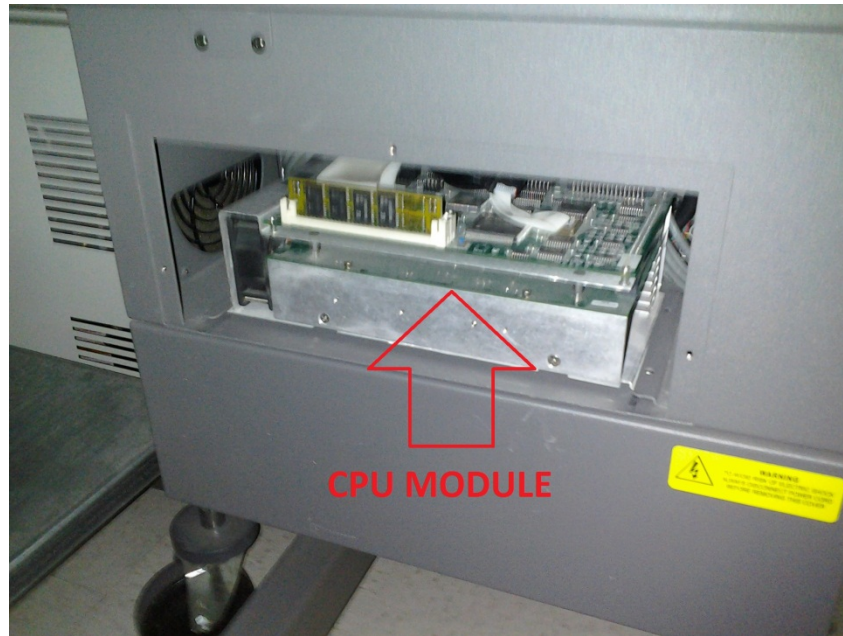

Step 3 – Look for the **Fail Safe** Button as shown in the picture. Disregard the Reset button in the picture shown below; most new CPUs do not have a Reset button but a **Fail Safe** button only. Plug the main power cord back into the engraver.

Depress the **Fail Safe** Button and turn on the machine on while continuing to hold the **Fail Safe** button until the machine initializes. Continue to hold the **Fail Safe** button until the LCD display on the engraver says READY. Once the display says Ready, let go of the Fail Safe button. Reflash is complete.

